

LP2 probe system



EN		Publications for this product are available by scanning the barcode or visiting www.renishaw.com/lp2 .	
DE		Für dieses Produkt stehen weitere Informationen zur Verfügung. Scannen Sie dazu den Barcode oder besuchen Sie www.renishaw.de/lp2 .	
FR		Les documentations pour ce produit sont disponibles en scannant le code barres ou en visitant www.renishaw.fr/lp2 .	
IT		Le pubblicazioni relative a questo prodotto sono disponibili scansionando il codice a lato oppure visitando il sito: www.renishaw.it/lp2 .	

PL		<p>Dostęp do dokumentacji tego produktu można uzyskać, skanując kod kreskowy lub odwiedzając witrynę www.renishaw.pl/lp2.</p>	
PT		<p>Para conteúdo sobre este produto, digitalize o código de barras ou visite www.renishaw.com.br/lp2.</p>	
RU		<p>Если вас интересует информация об этом продукте, отсканируйте штрих-код или посетите сайт www.renishaw.ru/lp2.</p>	
中文 (简体)		<p>可通过以下方式获得此产品的相关文档： 扫描二维码，或访问 www.renishaw.com.cn/lp2。</p>	
한국어		<p>본 제품에 대한 간행물은 바코드를 스캔하거나 다음을 방문하여 확인하실 수 있습니다 www.renishaw.co.kr/lp2.</p>	

© 2000–2020 Renishaw plc. All rights reserved.

This document may not be copied or reproduced in whole or in part, or transferred to any other media or language by any means, without the prior written permission of Renishaw.

Renishaw plc. Registered in England and Wales.
Company no: 1106260. Registered office:
New Mills, Wotton-under-Edge, Gloucestershire,
GL12 8JR, UK.

Renishaw part no: H-2000-5021-07-A

Issued: 10.2020

Safety	2	Machining centres (hard-wired transmission).....	18
Introduction	4	Machining centres (hard-wired transmission, tool setting)	19
LP2 probe types	5	Lathes (radio transmission).....	20
LP2 modular system	6	Lathes (optical transmission)	21
LP2 probe moves	7	Lathes (hard-wired transmission).....	22
Specification	9	Stylus spring pressure adjustment – gauging force	23
Dimensions	11	Stylus on-centre adjustment with probe holders and sockets	24
Recommended connection diagram for LP2 with HSI-C interface	12	Stylus on-centre adjustment with shank adaptor or shank	25
Recommended connection diagram for LP2 with HSI interface	13	Screw torque values	27
Recommended connection diagram for LP2 with MI 8-4 interface	14	Software requirements	28
Typical LP2 probe systems	15	Service and maintenance	29
Machining centres (radio transmission).....	15	Fault-finding	31
Machining centres with OMM-2 with OSI or OSI-D interface or OMI-2 / OMI-2T / OMI-2H interface/receiver (optical transmission)	16	Part list	33
Machining centres with an OMM-2C with OSI or OSI-D interface (optical transmission)	17	General information	35

Safety

Information to the user

In all applications involving the use of machine tools or CMMs, eye protection is recommended.

Refer to the machine supplier's operating instructions.

The LP2 system must be installed by a competent person, observing relevant safety precautions. Before starting work, ensure that the machine tool is in a safe condition with the power switched OFF and the power supply to the HSI-C / HSI / MI 8-4 is disconnected.

Information to the machine supplier/installer

It is the machine supplier's responsibility to ensure that the user is made aware of any hazards involved in operation, including those mentioned in Renishaw product literature, and to ensure that adequate guards and safety interlocks are provided.

If the probe fails, the probe signal may falsely indicate a probe seated condition. Do not rely on probe signals to halt the movement of the machine.

Information to the equipment installer

All Renishaw equipment is designed to comply with the relevant EU and FCC regulatory requirements. It is the responsibility of the equipment installer to ensure that the following guidelines are adhered to, in order for the product to function in accordance with these regulations:

- any interface MUST be installed in a position away from any potential sources of electrical noise (for example, power transformers, servo drives);
- all 0 V/ground connections should be connected to the machine "star point" (the "star point" is a single point return for all equipment ground and screen cables). This is very important and failure to adhere to this can cause a potential difference between grounds;

- all screens must be connected as outlined in the user instructions;
- cables must not be routed alongside high current sources (for example, motor power supply cables), or be near high-speed data lines;
- cable lengths should always be kept to a minimum.

Equipment operation

If this equipment is used in a manner not specified by the manufacturer, the protection provided by the equipment may be impaired.

Introduction

The LP2 is a compact and versatile probe for applications on CNC lathes and machining centres. A wide range of styli and accessories is available to provide custom installations.

Principal applications

Horizontal lathes

Small enough to fit on a turret for part measuring, tool setting and broken tool detection when mounted in a suitable position.

Machining centre applications

Set-up and part measuring when spindle mounted. Tool setting and broken tool detection when table mounted.

Signal transmission systems

- Hard-wired – a range of hard-wired probe sockets is available for inspection and tool setting applications. For machining centres with manual tool change the LP2 will fit the MA2 probe holder.

- Optical or radio – for lathes and machining centres. Easy installation, particularly in retrofit applications because there is no need for the prepared passageways required for hard-wired transmission cables. LP2 can be used with OMP40M, OMP60M, RMP40M, RMP60M.

Interface unit

A hard-wired installation with LP2 may use the following interfaces:

- HSI-C interface, see the *HSI-C hard-wired system interface – configurable* installation guide (Renishaw part no. H-6527-8501).
- HSI interface, see the *HSI hard-wired system interface* installation guide (Renishaw part no. H-5500-8554).
- MI 8-4 interface, see the *MI 8-4 interface unit* installation and user's guide (Renishaw part no. H-2000-5008).

The FS1i and FS2i probe sockets with integral interface may also be used, see the *FS1i and FS2i sockets* data sheet (Renishaw part no. H-2000-2073).


There are four versions of the LP2 probe. Each version is best suited to particular applications.


LP2 – For normal setting/inspection. The metal eyelid protects the diaphragm in a hot chip and coolant environment.

LP2H – With higher stylus pressure for long or heavy styli, or where there is excessive machine vibration.

LP2DD – LP2HDD – The double diaphragm (DD) arrangement is recommended for grinding machines and other applications with particle-laden coolant. The LP2HDD is a version with a higher stylus spring pressure, similar to the LP2H.

1. Stylus – M4 thread
2. Metal eyelid
3. Spring
4. Diaphragm
5. Rear O-ring
6. M16 thread
7. Stylus spring pressure adjustment
8. Swarf deflector – essential for LP2DD and LP2HDD when continually exposed to hot chips.

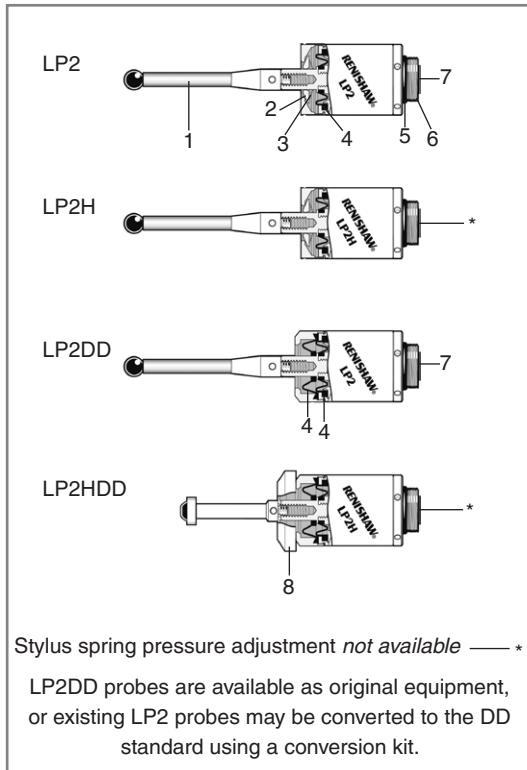

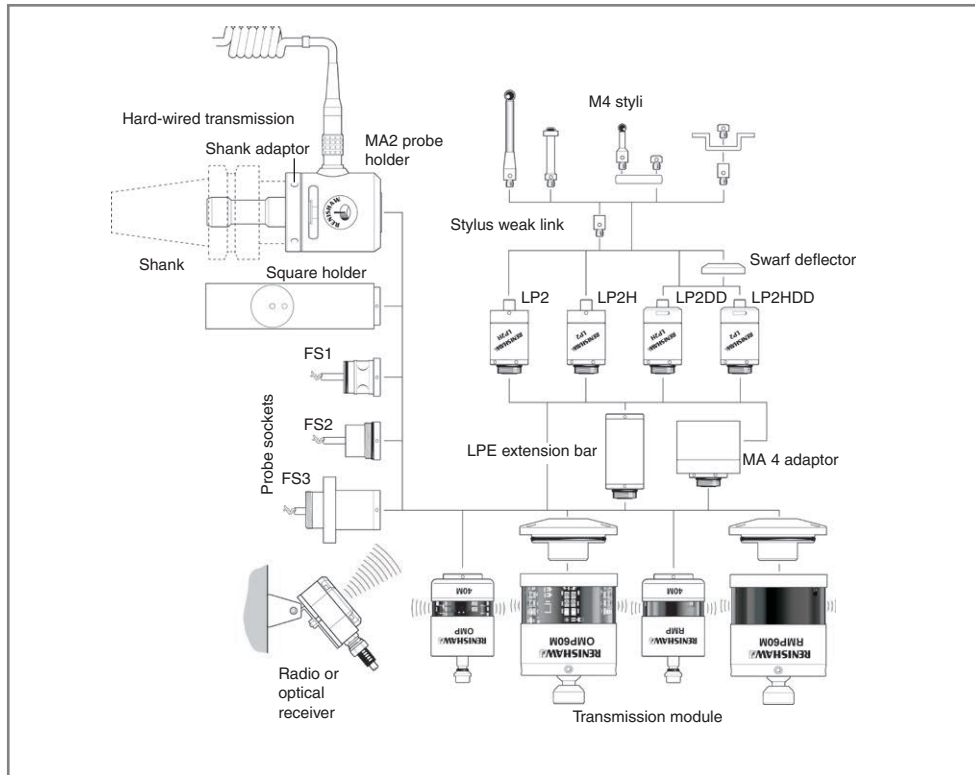

Probe trigger

A probe trigger signal is generated when the probe's stylus is driven against a surface. The machine control records the contact position and instructs the machine motion to stop.

Although high probing speeds are desirable, it is essential to choose a probing velocity which allows the machine to stop within the limits of stylus overtravel and machine measuring capability. Follow feedrate guidelines given by the supplier.


To ensure a trigger signal is generated, drive the probe against the workpiece to a target beyond the expected surface, but within the limits of stylus overtravel.

After the probe stylus touches the surface, reverse clear of the surface.


Single and double touch

If the probe operating sequence is based on a single touch, then, following a gauging move, the probe may be returned to its start point.

With some types of controllers, it is an advantage to use a double touch method as poor repeatability can result from using higher feedrates.

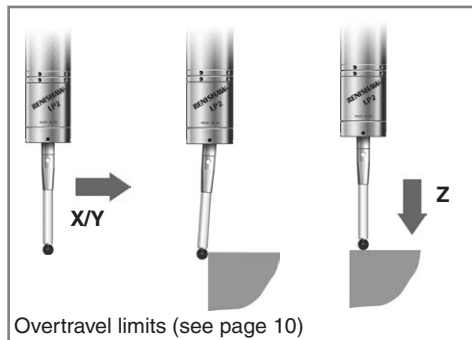

With a double touch sequence, the first move finds the surface quickly, then the probe is reversed to a position clear of the surface before making the second touch at a slower feedrate, thereby recording the surface position at a higher resolution.

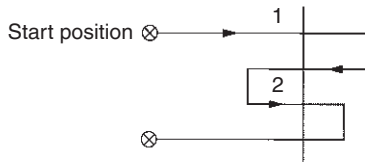

System delays

System delays are repeatable to less than 2 μ s, and are constant in each direction in which measurement is taken.

Delays are automatically compensated for, provided a calibration move is made in the same direction and at the same velocity as each measurement move.

Calibrating a system

Calibrate the probe system at a constant measurement speed in the measurement direction, to automatically compensate for errors, in the following circumstances:

1. Before the system is used.
2. When a new stylus is used.
3. If the stylus is bent.
4. To allow for machine thermal growth.
5. Where there is poor shank relocation repeatability in the machine spindle.

Variants		LP2 / LP2DD	LP2H / LP2HDD
Principal application		Workpiece inspection and job set-up on all sizes of lathes, machining centres and CNC grinders.	
Transmission type		Hard-wired, or in conjunction with optical or radio transceiver modules.	
Compatible interfaces	Hard-wired	HSI, HSI-C, MI 8-4, FS1i or FS2i	
	Optical	OMI-2 / OMI-2T / OMI-2H / OSI or OSI-D with OMM-2 or OMM-2C	
	Radio	RMI-Q	
Recommended styli		50 mm (1.97 in) to 100 mm (3.94 in) Stylus material depends on application.	50 mm (1.97 in) to 150 mm (5.91 in) Stylus material depends on application.
Weight		65 g (2.29 oz)	
Sense directions		±X, ±Y, +Z	
Unidirectional repeatability		1.00 µm (40 µin) 2σ (see note 1)	2.00 µm (80 µin) 2σ (see note 1)
Stylus trigger force (see notes 2 and 3)			
XY low force		0.50 N, 51 gf (1.80 ozf)	2.00 N, 204 gf (7.19 ozf)
XY high force		0.90 N, 92 gf (3.24 ozf)	4.00 N, 408 gf (14.39 ozf)
+Z direction		5.85 N, 597 gf (21.04 ozf)	30.00 N, 3059 gf (107.91 ozf)

Stylus overtravel limits	LP2	LP2DD	LP2H	LP2HDD
$\pm X / \pm Y$	14.87 mm (0.55 in) $\pm 12.5^\circ$	19.06 mm (0.73 in) $\pm 15^\circ$	14.87 mm (0.55 in) $\pm 12.5^\circ$	19.06 mm (0.73 in) $\pm 15^\circ$
Z	6.5 mm (0.26 in) 4.5 mm (0.18 in) when fitted with a swarf deflector		5.0 mm (0.20 in) 4.5 mm (0.18 in) when fitted with a swarf deflector	
Mounting	M16 thread, for LPE extension bars and adaptors.			
Sealing	IPX8, BS EN 60529:1992+A2:2013 (IEC 60529:1989+A1:1999+A2:2013)			
Storage temperature	-25 °C to +70 °C (-13 °F to +158 °F)			
Operating temperature	+5 °C to +55 °C (+41 °F to +131 °F)			


Note 1 Performance specification is tested at a standard test velocity of 480 mm/min (18.9 in/min) with a 35 mm stylus. Significantly higher velocity is possible depending on application requirements.

Note 2 Trigger force, which is critical in some applications, is the force exerted on the component by the stylus when the probe triggers. The maximum force applied will occur after the trigger point (overtravel). The force value depends on related variables including measuring speed and machine deceleration.


Note 3 These are the factory settings; manual adjustment of the LP2 / LP2DD is possible, but the LP2H / LP2HDD is not adjustable.

NOTE: For stylus recommendations, refer to the *Styli and accessories* technical specification (Renishaw part no. H-1000-3200).

LP2 – LP2H

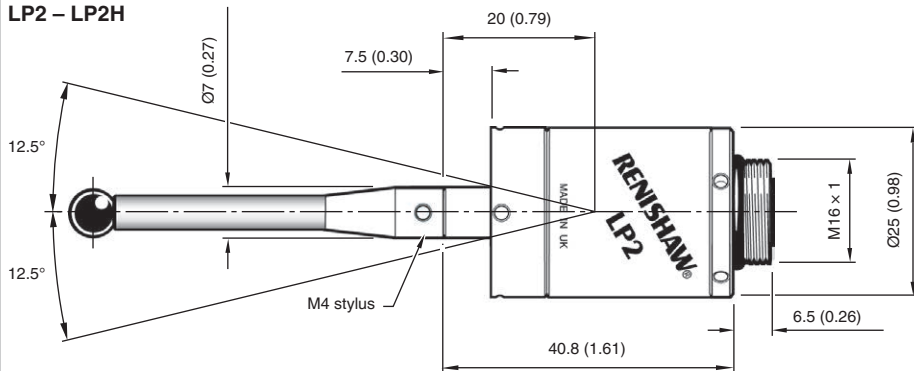


LP2DD – LP2HDD

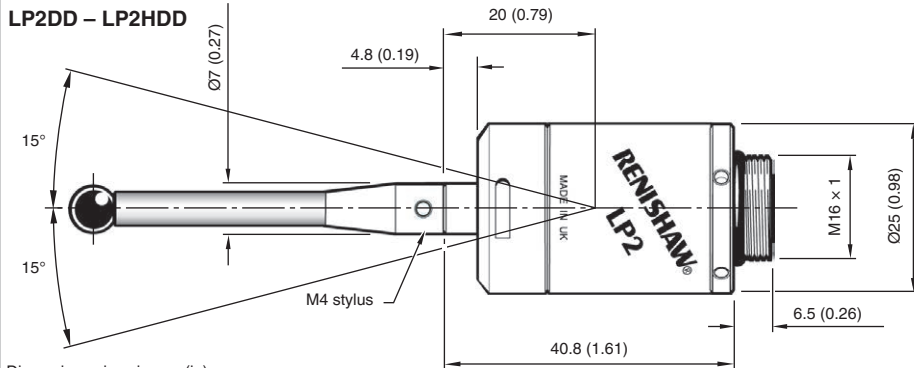

Dimensions given in mm (in)

FS1*/FS2* probe holder fixed socket for standard probe

* No screen connection

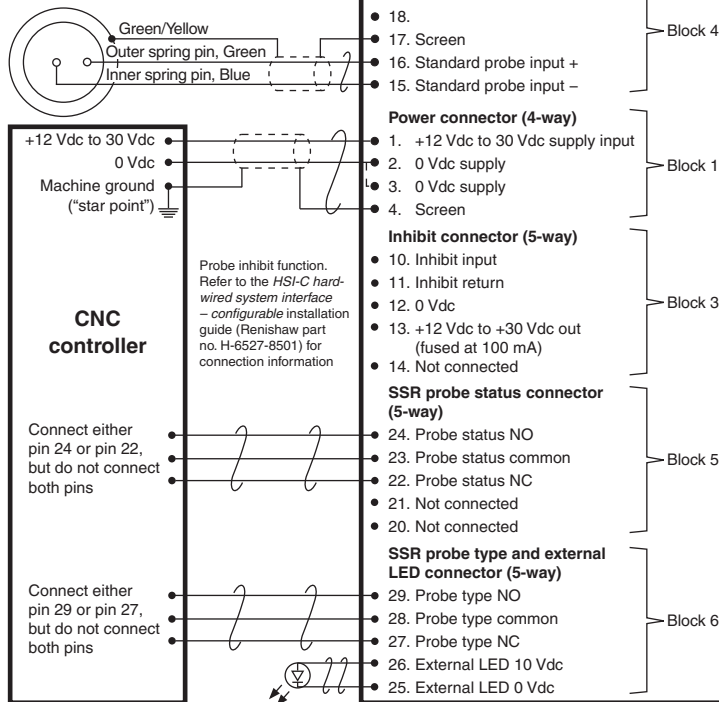


NOTES:


When connecting the LP2 probe to the HSI-C interface, use the connection labelled STANDARD PROBE.

When the SSR output is connected as normally open (NO), the LP2 probe will remain in the non-triggered (seated) state if the power supply is interrupted or if the probe is damaged.

Probe status	Normally open (NO)	Normally closed (NC)
Probe triggered	Closed	Open
Probe seated	Open	Closed


 


Probe holder fixed socket for LP2 probe

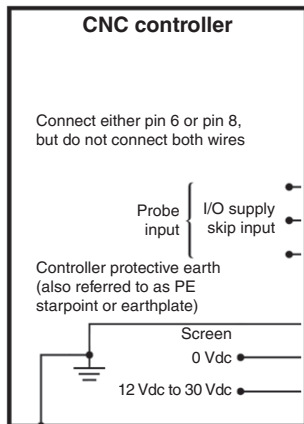

Controller reference ground

Probe inhibit function, see HSI hard-wired system interface installation guide (Renishaw part no. H-5500-8554)

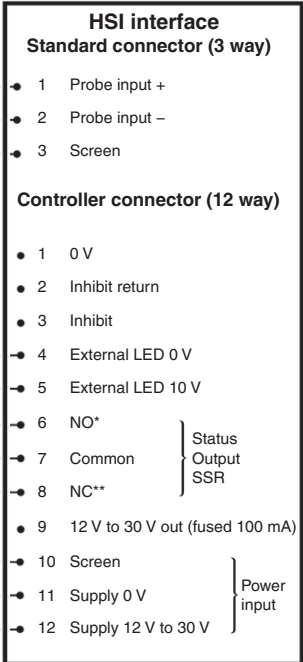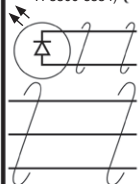


NOTES:


When connecting the LP2 probe to the HSI interface, use the connection labelled STANDARD PROBE.

When the SSR output is connected as normally open (NO), the LP2 probe will remain in the non-triggered (seated) state if the power supply is interrupted or if the probe is damaged.


Probe status	*Normally open (NO)	**Normally closed (NC)
Probe triggered	Closed	Open
Probe seated	Open	Closed

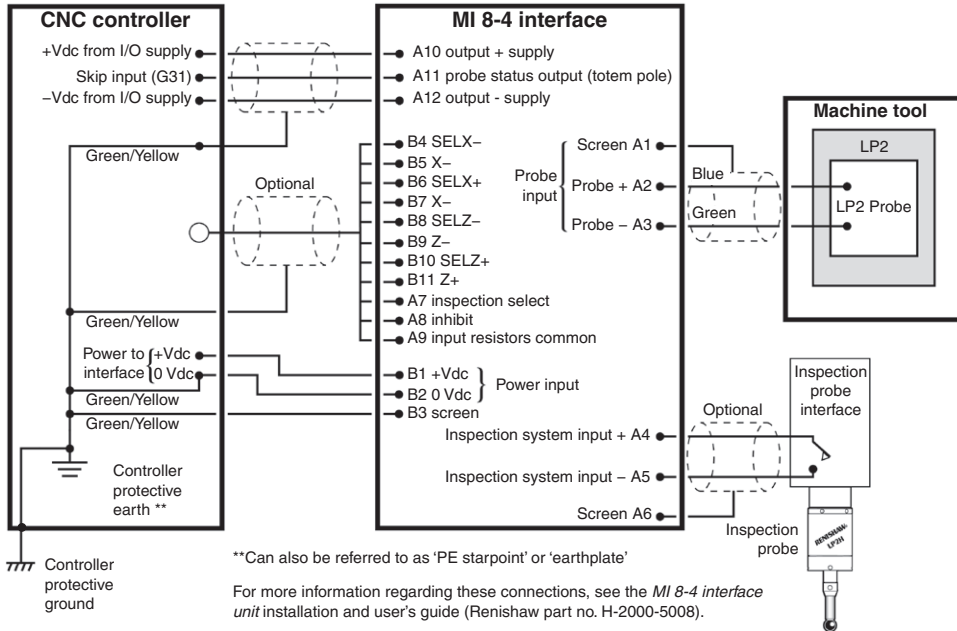


Machining centres (radio transmission)

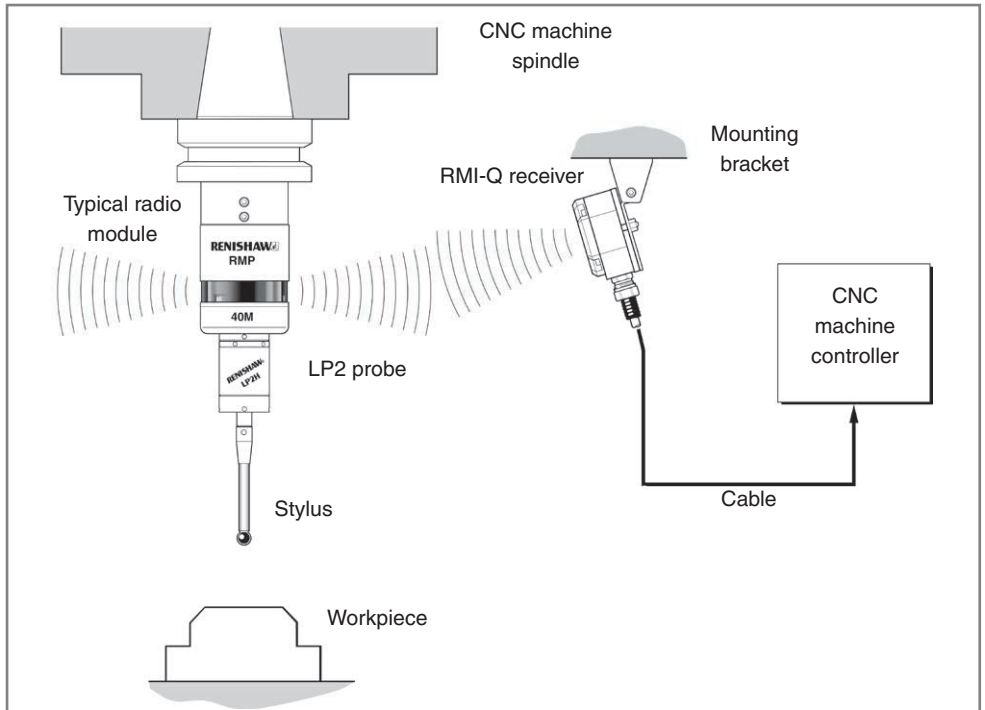


Machining centres with OMM-2 with OSI or OSI-D interface or OMI-2 / OMI-2T / OMI-2H interface/receiver (optical transmission)

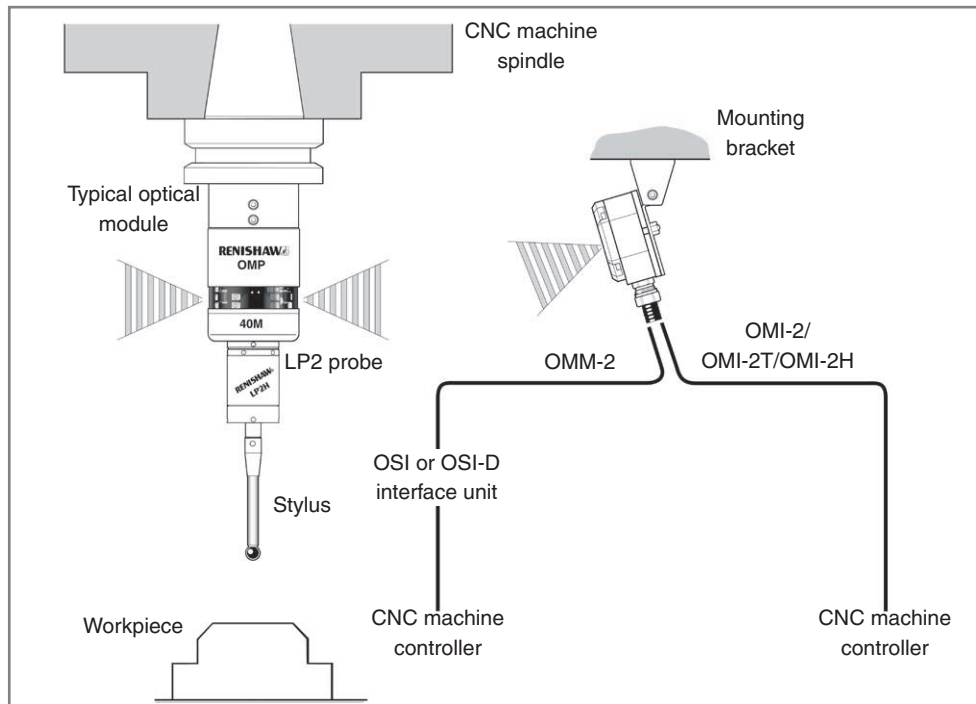

**Machining centres with an OMM-2C with OSI or OSI-D interface
(optical transmission)**

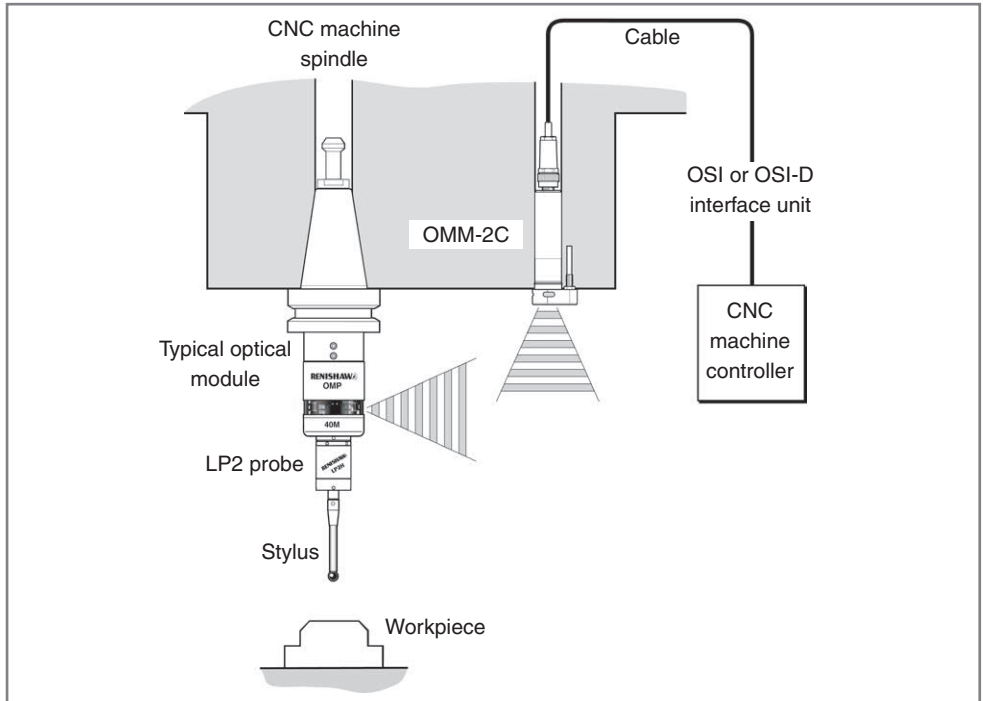


Machining centres (hard-wired transmission)

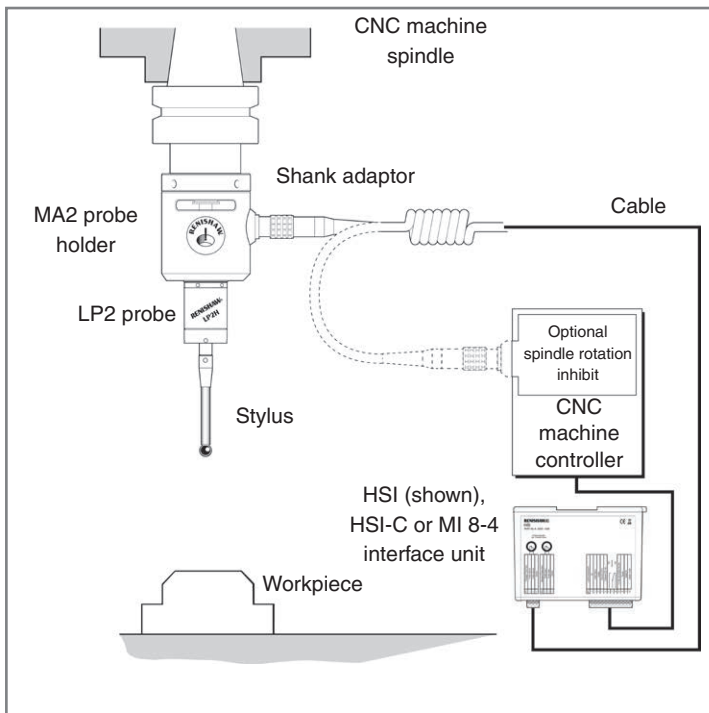


WARNING: The probe should not be rotated (**spun**) by the machine when the curly cable is connected, as persons may be injured by flying cable or entanglement.


Machining centres (hard-wired transmission, tool setting)

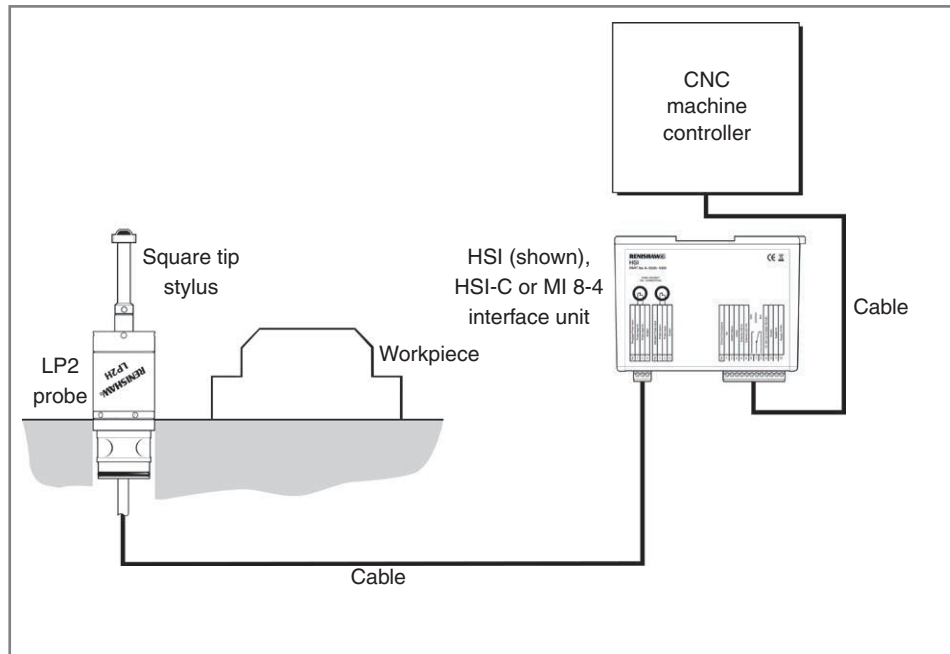


Lathes (radio transmission)

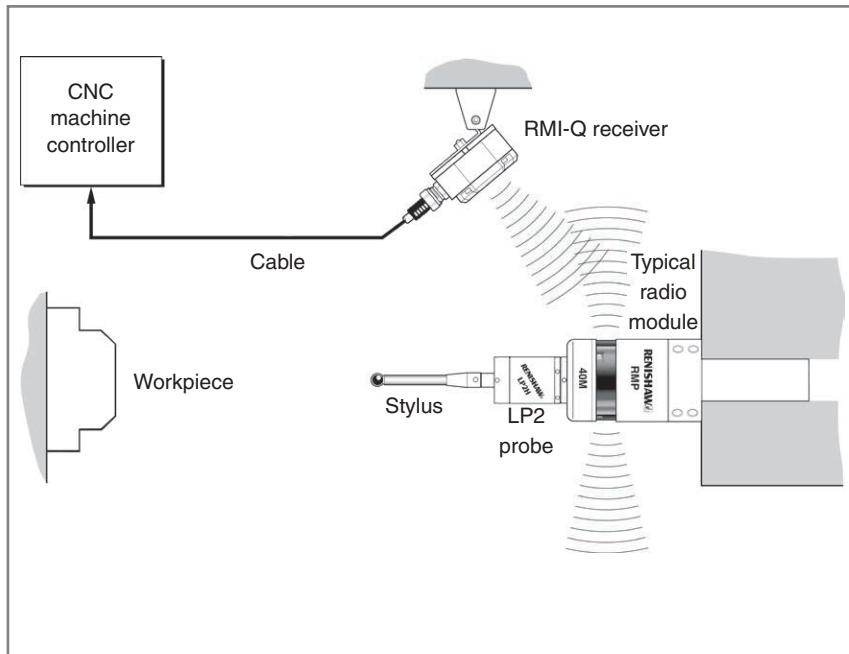

Lathes (optical transmission)

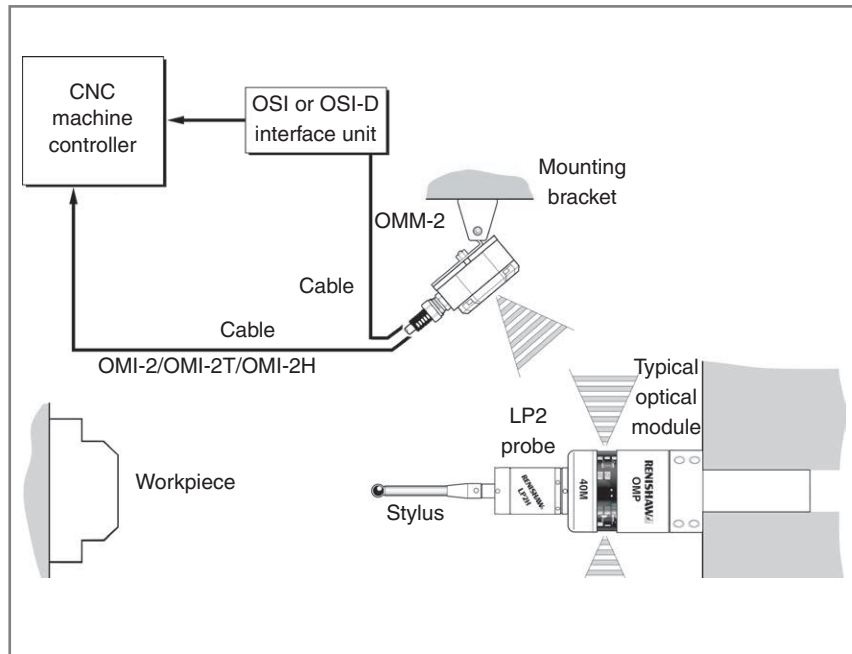

Lathes (hard-wired transmission)

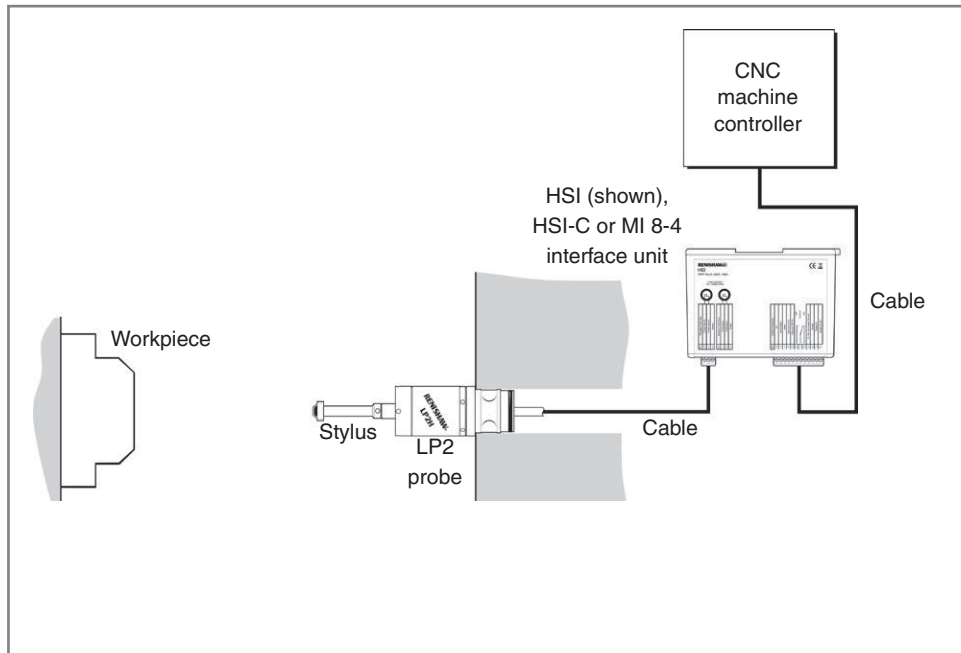

LP2 and LP2DD are adjustable

LP2H and LP2HDD are not adjustable

Stylus trigger force is determined by the internal spring pressure set by Renishaw. The user should only adjust the spring pressure in special circumstances; for example, when excessive machine vibration causes faulty readings or there is insufficient pressure to support the stylus weight.

Low pressure improves probe sensitivity. To lower the pressure, turn the key anti-clockwise as far as required: it will eventually come to a stop.

To increase the pressure, turn the key clockwise. Take care, as the internal screw will eventually become disengaged. In the event of this happening, remove any pressure on the stylus and turn the key anti-clockwise to re-engage the thread. If this is unsuccessful, return the probe to your supplier for repair.

CAUTION: Stylus spring pressure adjustment, and use of styli other than a calibration stylus type, may cause probe repeatability to differ from the calibration certificate results.



Stylus on-centre adjustment

Stylus position is established using a setting gauge or dial test indicator.

Lathes – inspection

The stylus is set to the same height as the spindle centre line to avoid errors when gauging diameters. The stylus tip position should correspond to the normal tool tip position for efficient programming.

1. MA4 90° adaptor

The probe is set through 360°.

2. FS3 adjustable holder

The holder pivots on two Ø6 mm balls. Two opposing screws permit $\pm 4^\circ$ fine rotational adjustment.


3. Square holder

Two opposing screws permit $\pm 4^\circ$ fine rotational adjustment.


Lathes and machining centres


4. Tool setting

The square tip of the stylus must align exactly with the machine's X and Y axes (machining centres) and X axis (lathes). Coarse alignment is obtained by adjusting the stylus tip. The optional FS1 socket provides $\pm 4^\circ$ fine rotational adjustment.

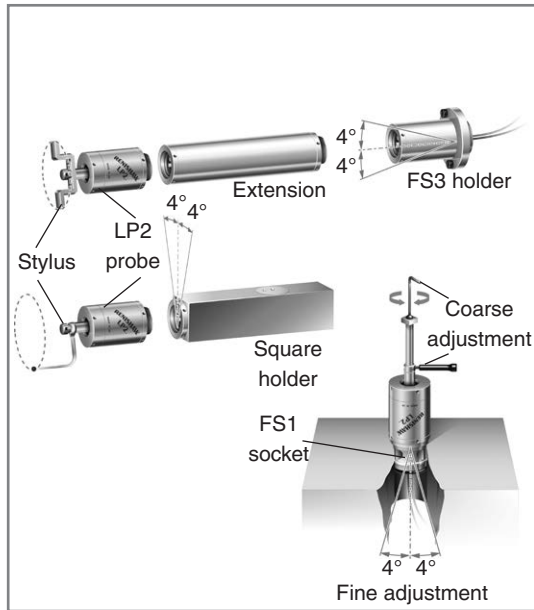

1. **Shank adaptor only** (see figure on page 26)
– fit shank adaptor onto shank and tighten the shank screws.
2. Attach the MA2 to the shank or shank adaptor. Tighten the two MA2 holding screws, then unscrew half a turn.
3. Centralise the two MA2 screws at mid-position in the MA2 slots.
4. Fit the four on-centre adjusting screws loosely.
5. Insert the probe unit into the machine spindle.
6. Position the dial test indicator (D.T.I.) against the stylus, with light pressure so as not to deflect the stylus.
7. Connect the curly cable to the MA2 and interface.
8. Switch the power on to monitor any accidental probe trigger during adjustment.
9. Engage the machine spindle in a neutral or high gear for easy manual rotation. Check the D.T.I. during spindle rotation.
10. Adjust the four adjusting screws one at a time. Following each adjustment, unscrew the active screw clear of the centre shaft. Repeat until the stylus is on-centre. Finally, tighten the two MA2 holding screws and four on-centre adjusting screws.

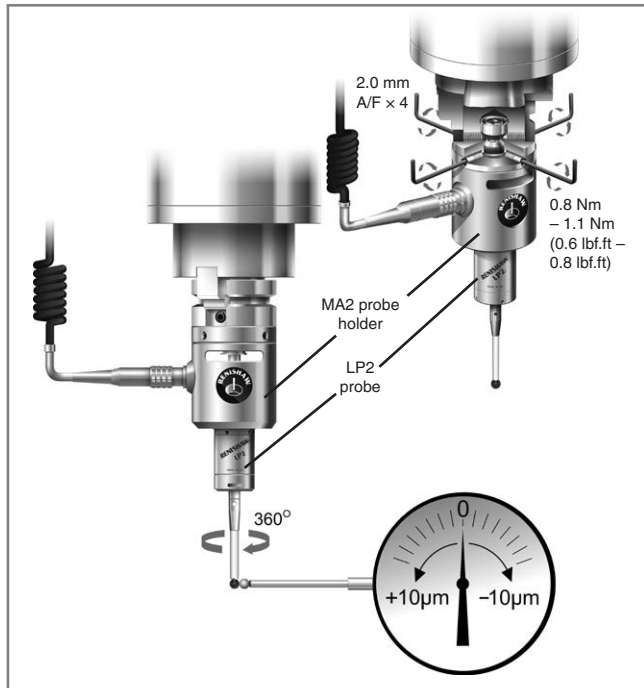

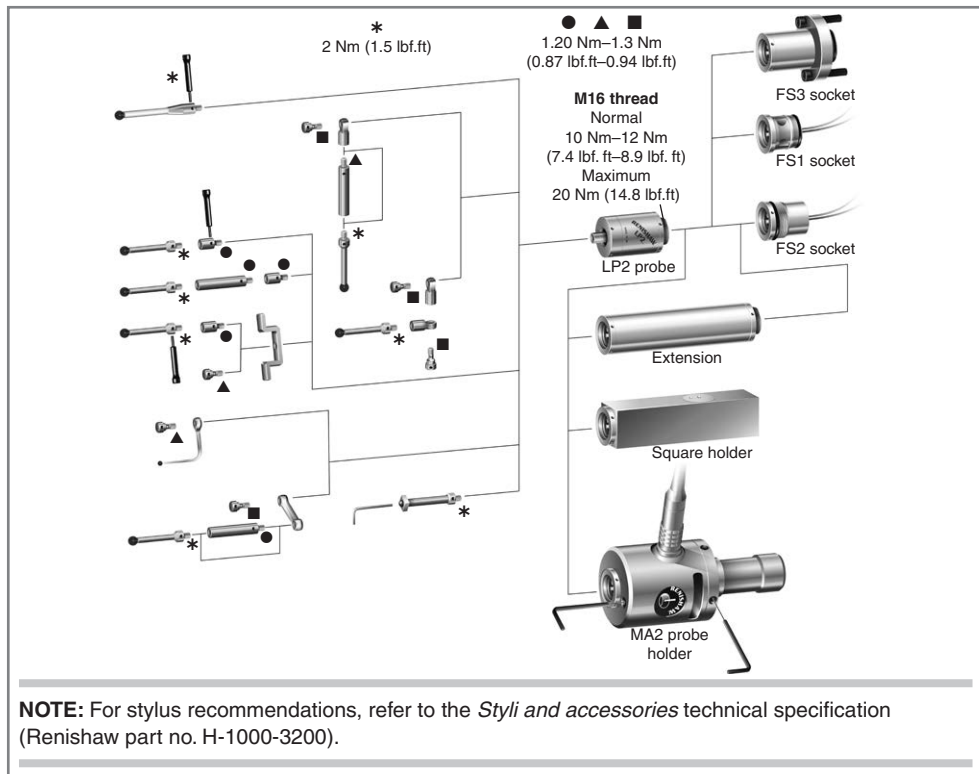

Software for turning and machining centres**Effective software will do the following:**

- Offer simple to use calibration routines.
- Update a tool offset.
- Generate an alarm if a broken tool is found or set a flag for corrective action.
- Update work co-ordinate systems for positioning.
- Report measured sizes and update tool offsets for automatic tool offset compensations.
- Print data in the form of an inspection report to an external PC/printer.
- Set tolerances on features.

NOTE: Probe cycles and features are machine software dependent. Software for probing routines is available from Renishaw.

Verify your software

1. Does your software have suitable calibration routines which compensate for stylus on-centre errors? If not, you must set the probe stylus on-centre mechanically.

NOTE: For machining centre applications, when using probe styli which are not on spindle centre, spindle orientation repeatability is important to avoid probe measurement errors.

2. Does your software compensate for probe triggering characteristics in all measuring directions?
3. Does the software automatically adjust the program co-ordinate system to the relevant set-up feature on the component, for job set-up purposes?

Service

You may undertake the maintenance routines described in this handbook.

Further dismantling and repair of Renishaw equipment is a highly specialised operation, which must be carried out at authorised Renishaw service centres.

Equipment requiring repair, overhaul or attention under warranty should be returned to your supplier.

Maintenance

CAUTION: The probe is a precision tool and must be handled with care.

The probe is designed to operate in a machine tool environment. Do not allow chips to build up around the probe body, and do not allow dirt or liquids to enter the sealed working parts. Keep system mating surfaces clean, and ensure that inductive transmission gaps are clear. Periodically check the probe's rear O-ring, cables and connections for signs of damage and slackness.

Cleaning the probe front seal

LP2 – LP2H

Dirt may accumulate in the cavity underneath the metal eyelid seal.

LP2DD – LP2HDD


Dirt may accumulate in the cavity underneath the outer diaphragm. (Outer diaphragm replacement kits are available.)

LP2 – LP2H – LP2DD – LP2HDD

Once a month, remove the stylus front cap (the C spanner is provided for easy cap removal) then remove all the residue with a low-pressure jet of coolant. Do not use a sharp tool or a degreasing agent. The cleaning interval may be extended or reduced, depending on the rate at which dirt accumulates. If the inner diaphragm is damaged, return the probe to your supplier for repair.

Re-assembling the components

CAUTION: Do not use the probe with the cap removed. Check that the probe is firmly secured in its mounting.

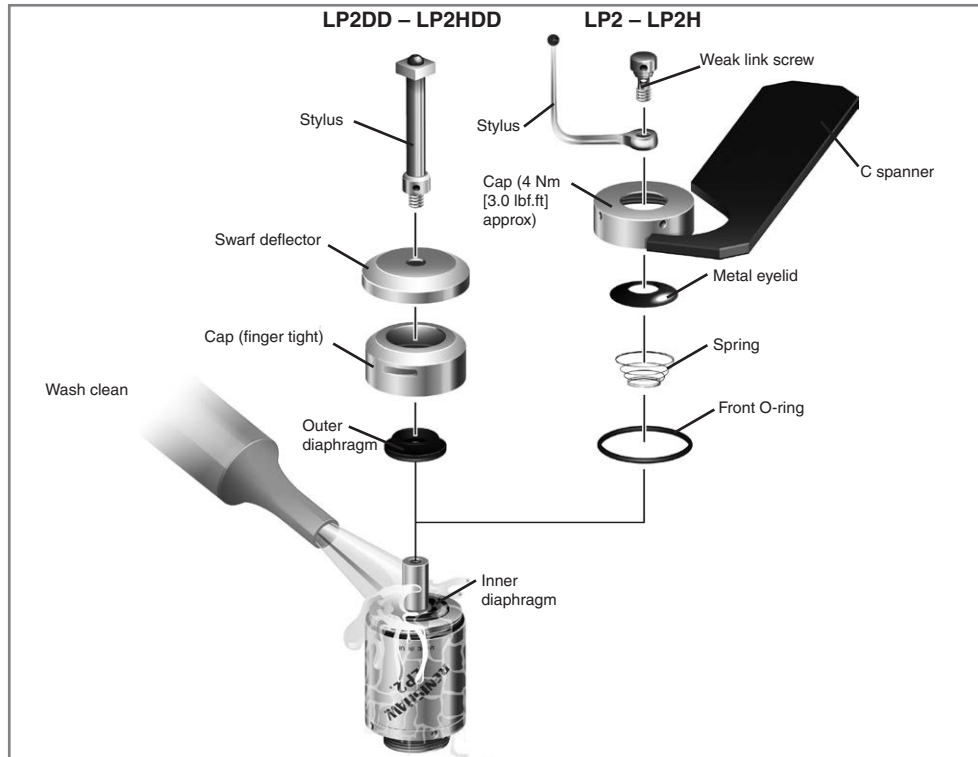

Symptom	Cause	Action
Complete failure.	Transmission modules not correctly aligned.	Align correctly.
	Transmission modules damaged.	Return to supplier for repair. For information on transmission, refer to the relevant installation guide.
	Swarf blocking inductive transmission air gap.	Clean out.
	Loose mounting.	Check all bolted or screwed connections for tightness.
	Interface LED does not light up.	Check fuses.
	Poor electrical connection.	Check connectors.
	Cable screen broken.	Replace cable.
	Incorrect voltage.	Check supply.
	Probe failure.	No continuity through probe circuit.
	Probe spring pressure too low.	Tighten stylus spring pressure.
Probe mounting damaged.	Repair or replace.	

Symptom	Cause	Action
Poor repeatability.	Transmission modules not correctly aligned.	Align correctly.
	Loose mounting.	Check all bolts and screwed connections for tightness.
	Loose stylus.	Tighten.
	Poor electrical connections.	Check connectors.
	Excessive machine vibration.	Tighten spring pressure.
Spurious reading.	Cable screen broken.	Replace.
	Poorly regulated supply voltage.	Regulate correctly.
	Excessive machine vibration.	Eliminate vibration or adjust stylus spring pressure.
Poor re-arming (probe is seated and the status LED is either red or not illuminated).	Spring pressure too low.	Adjust spring pressure.
	Inner diaphragm pierced or damaged.	Return to supplier for repair.

Type	Part number	Description
LP2	A-2063-6098	LP2 probe complete with two C spanners and TK1 tool kit.
LP2DD	A-2063-8020	LP2DD probe complete with two C spanners and probe head tool kit.
LP2H	A-2064-0002	LP2H probe complete with two C spanners and TK1 tool kit.
LP2HDD	A-2064-0032	LP2HDD probe complete with two C spanners and probe head tool kit.
MA2 holder	A-2063-7868	MA2 probe holder, complete with holding screws.
Adaptor	M-2063-7865	Shank adaptor for MA2 probe holder, complete with holding screws.
Cable	A-1016-6451	Cable assembly for MA2 probe holder.
Service kit	A-2063-7542	LP2 service kit comprises: front cover, eyelid seal, spring and O-rings.
Deflector	M-2063-8003	Swarf deflector, Ø28 mm, protects probe from hot swarf.
Diaphragm kit	A-2063-8030	Outer diaphragm and O-ring replacement kit.
Conversion kit	A-2063-8023	The kit converts LP2 and LP2H probes to the DD standard, comprising : front ring, outer diaphragm, O-ring, two C spanners.
PS3-1C	A-5000-3709	Ceramic stylus 50 mm long with Ø6 mm ball.
PS2-41	A-5000-6403	Square tool setting stylus.
Protection	M-5000-7582	Stylus adaptor with weak link collision protection for straight steel styli.
Protection	M-5000-7587	Screw with weak link collision protection for straight steel styli.
Protection	M-5000-7588	Screw with weak link collision protection for swivel adaptor.
TK1	A-2053-7531	Probe head tool kit.

Type	Part number	Description
C spanner	A-2063-7587	C spanner.
MI 8-4 interface	A-2157-0001	MI 8-4 interface unit with dual lock pads and DIN rail mounting, installation and user's guide and packaging.
HSI interface	A-5500-1000	HSI probe system interface with DIN rail mounting and three terminal blocks, quick-start guide and packaging.
HSI-C interface	A-6527-1000	HSI-C probe system interface, quick-start guide and packaging.
Terminal block (HSI-C only)	P-CN47-0082	4-way terminal block (1 off required).
Terminal block (HSI-C only)	P-CN47-0083	5-way terminal block (5 off required).
Terminal label set (HSI-C only)	M-5358-0202	HSI-C terminal labels
Publications. These can be downloaded from our website at www.renishaw.com .		
MI 8-4	H-2000-5008	Installation and user's guide: MI 8-4 interface unit.
HSI	H-5500-8550	Quick-start guide: for rapid set-up of the HSI interface.
HSI-C	H-6527-8500	Quick-start guide: for rapid set-up of the HSI-C interface.
Styli	H-1000-3200	Styli and accessories technical specifications.
Probe software	H-2000-2298	Data sheet: Probe software for machine tools – programs and features.

Disclaimer

WHILE CONSIDERABLE EFFORT WAS MADE TO VERIFY THE ACCURACY OF THIS DOCUMENT AT PUBLICATION, ALL WARRANTIES, CONDITIONS, REPRESENTATIONS AND LIABILITY, HOWSOEVER ARISING, ARE EXCLUDED TO THE EXTENT PERMITTED BY LAW.

RENISHAW RESERVES THE RIGHT TO MAKE CHANGES TO THIS DOCUMENT AND TO THE EQUIPMENT, AND/OR SOFTWARE AND THE SPECIFICATION DESCRIBED HEREIN WITHOUT OBLIGATION TO PROVIDE NOTICE OF SUCH CHANGES.

Trade marks

RENISHAW® and the probe symbol are registered trade marks of Renishaw plc. Renishaw product names, designations and the mark 'apply innovation' are trade marks of Renishaw plc or its subsidiaries. Other brand, product or company names are trade marks of their respective owners.

Warranty

Unless you and Renishaw have agreed and signed a separate written agreement, the equipment and/or software are sold subject to the Renishaw Standard Terms and Conditions supplied with such equipment and/or software, or available on request from your local Renishaw office.

Renishaw warrants its equipment and software for a limited period (as set out in the Standard Terms and Conditions), provided that they are installed and used exactly as defined in associated Renishaw documentation. You should consult these Standard Terms and Conditions to find out the full details of your warranty.

Equipment and/or software purchased by you from a third-party supplier is subject to separate terms and conditions supplied with such equipment and/or software. You should contact your third-party supplier for details.

China RoHS

For more information on China RoHS visit:

www.renishaw.com/mtpchinarohs.

Changes to equipment

Renishaw reserves the right to change equipment specifications without notice.

CNC machines

CNC machine tools must always be operated by fully trained personnel in accordance with the manufacturer's instructions.

Care of the probe

Keep system components clean and treat the probe as a precision tool.

EU declaration of conformity



Renishaw plc declares under its sole responsibility that the LP2 is in conformity with all relevant Union legislation.

The full text of the EU declaration of conformity is available at:

www.renishaw.com/mtpdoc

WEEE directive



The use of this symbol on Renishaw products and/or accompanying documentation indicates that the product should not be mixed with general household waste upon disposal. It is the responsibility of the end user to dispose of this product at a designated collection point for waste electrical and electronic equipment (WEEE) to enable reuse or recycling. Correct disposal of this product will help to save valuable resources and prevent potential negative effects on the environment. For more information, please contact your local waste disposal service or Renishaw distributor.

REACH regulation

Information required by Article 33(1) of Regulation (EC) No. 1907/2006 (“REACH”) relating to products containing substances of very high concern (SVHCs) is available at:

www.renishaw.com/REACH

FCC Information to user (USA only)

47 CFR Section 15.19

This device complies with part 15 of the FCC Rules. Operation is subject to the following two conditions:

1. This device may not cause harmful interference, and
2. This device must accept any interference received, including interference that may cause undesired operation.

47 CFR Section 15.21

The user is cautioned that any changes or modifications not expressly approved by Renishaw plc or authorised representative could void the user's authority to operate the equipment.

雷尼绍（上海）贸易有限公司

中国上海市静安区江场三路288号
18幢楼1楼
200436

T +86 21 6180 6416

F +86 21 6180 6418

E shanghai@renishaw.com

www.renishaw.com.cn

安全须知

用户须知

在所有涉及使用机床或坐标测量机 (CMM) 的应用中，建议采取保护眼睛的措施。

请参阅机床供应商的操作说明书。

LP2系统必须由有资质的人员在遵守相关安全措施的前提下进行安装。在开始工作之前，须确保机床电源关闭，处于安全状态，并且HSI-C / HSI / MI 8-4的电源已断开。

机床供应商/安装商须知

机床制造商有责任确保用户了解操作中存在的任何危险，包括雷尼绍产品说明书中所述的危险，并确保提供充分的防护装置和安全联动装置。

在某些情况下，测头信号可能错误指示测头已复位状态。切勿单凭测头信号来停止机床运动。

设备安装商须知

雷尼绍所有设备的设计均符合相关的EU和FCC监管要求I为使产品按照这些规定工作，设备安装商有责任保证遵守以下指导原则：

- 任何接口的安装位置必须远离任何潜在的电噪声源，如变压器、伺服系统驱动装置等；
- 所有0伏/接地连接都应当连接到机床接地终端上（“接地终端”是所有设备地线和屏蔽电缆的单点回路）。这一点非常重要，不遵守此规定会造成接地之间存在电位差；
- 所有屏蔽装置都必须按使用说明书中所述进行连接；

- 电缆线路不得与电机电源电缆等高电流源并行或靠近高速数据传输线；
- 电缆长度应始终保持最短。

设备操作

如果设备使用方式与制造商要求的方式不符，设备提供的保护功能可能会减弱。

Renishaw plc
New Mills, Wotton-under-Edge
Gloucestershire, GL12 8JR
United Kingdom

T +44 (0)1453 524524
F +44 (0)1453 524901
E uk@renishaw.com
www.renishaw.com

RENISHAW 
apply innovation™

For worldwide contact details, visit
www.renishaw.com/contact



H - 2000 - 5021 - 07