

- F10 SW3
- 0 Graph
- 1 Home
- 2 Tool
- 3 Probe
- 4 Tool Off
- 5 Origin Off
- 6 Macro
- 7 Edit Gcode
- 8 Cam View
- 9 File

- F11 SW4
- 0 F11S4_0
- 1 F11S4_1


F5

- F6 SW2
- 0 F6S2_0
- 1 F6S2_1
- 2 F6S2_2
- 3 F6S2_3
- 4 F6S2_4

F12 SW7 - F12S7_0, F12S7_1, F12S7_2, F12S7_3

F12 SW5 - F12S5_0, F12S5_1, F12S5_2, F12S5_3, F12S5_4

F12 SW6 - F12S6_0, F12S6_1, F12S6_3

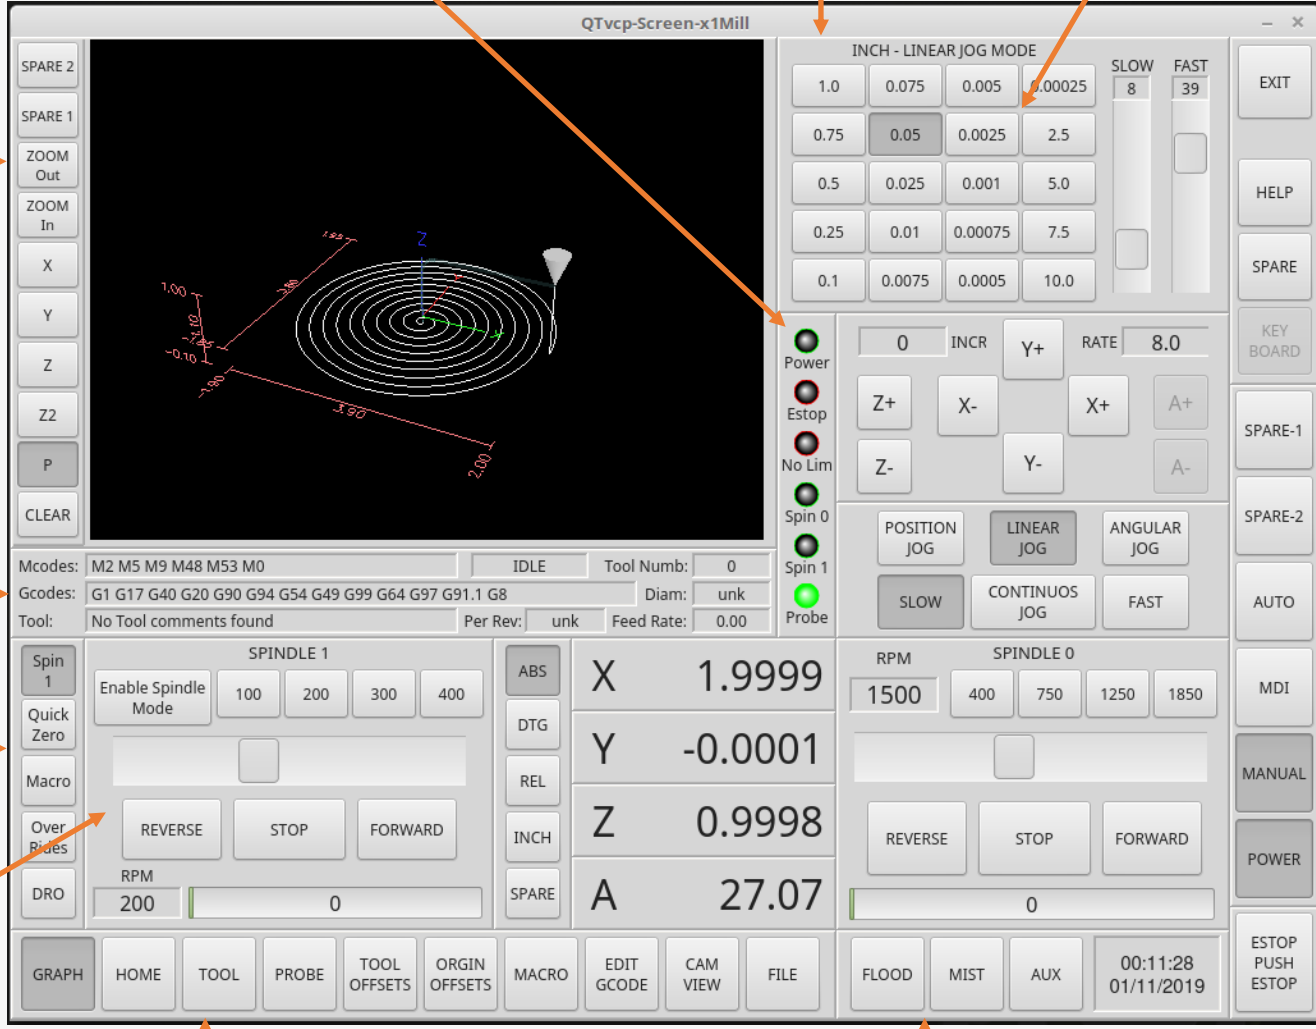

F2

F1

F0

F3

F4

The lower part from spindle to spindle area is SW1. SW1_0 is normal area, SW1_1 is keyboard area

SW0_0 is main display SW_1 is max screen display area. Bottom horizontal and right vertical buttons remain

x1Mill Gui items key map - 01-11-2019